



BRINGELANDS MASKINHANDEL AB
CERTIFIED PRE-AUCTION INSPECTION

• VERIFIED

REPORT INSP-2026-10-S590

INSPECTION REPORT

2022 BOBCAT S590

Compact Skid Steer Loader · Stock No. 007591

INSPECTION DATE

03 Oct 2026

ENGINE HOURS

930 h

INSPECTOR

C. Ruiz

CERTIFICATION

ES-MECH-7723



LOW HOURS – PASSED INSPECTION

Comprehensive on-site inspection completed by a certified heavy-machinery mechanic. With only **930 hours**, this machine is in excellent condition. Engine, hydraulics, transmission, cab, electrical, and all attachments were tested under no-load and light-load conditions. All systems operate to specification. No major faults found.



MACHINE IDENTIFICATION

PIN	B4ZE11461
CATEGORY	Compact Skid Steer Loader
MODEL NUMBER	S590
YEAR OF MANUFACTURE	2022
MANUFACTURER	Bobcat Company (Doosan Bobcat), Czech Republic
LICENSE PLATE	E-3495-BHS (ES)
CURRENT LOCATION	Burgos, Spain



KEY SPECIFICATIONS

OVERALL DIMENSIONS (L×W×H)	3.37 m × 1.64 m × 1.97 m
NET WEIGHT	3,127 kg
GROSS WEIGHT	4,106 kg
LOAD CAPACITY	979 kg
DUMPING HEIGHT	3.78 m
MAX SPEED	17.3 km/h
RUNNING HOURS	930 m/h
ENGINE	Hyundai DM02VB 4-Cylinder Diesel
POWER	50.7 kW (68.98 HP) @ 2,600 rpm
TYRE SIZE	10 - 16.5 NHS
TYRE CONDITION	80%
ATTACHMENTS	Bucket, pallet forks
DRIVE	4×4
CONDITION	Used
YEAR OF MANUFACTURE	2022

✓ OPERATIONAL TEST LOG

COLD START	✓ Instant, minimal smoke
WARM IDLE (10 MIN)	✓ Stable, no misfire
LOADER CYCLE (FULL RANGE)	✓ Smooth, no drift
BUCKET FUNCTION	✓ Correct operation
PALLET FORK FUNCTION	✓ Correct operation
STEERING (LOCK TO LOCK)	✓ Responsive
BRAKE TEST	✓ Firm pedal
TRANSMISSION (FORWARD/REVERSE)	✓ No slip
4×4 DRIVE ENGAGEMENT	✓ Functional
ELECTRICAL SYSTEMS	✓ All functional
ROAD LIGHTING & BEACON	✓ All functional

🛡️ FLUID CONDITION REPORT

ENGINE OIL	✓ Clean, correct level
ENGINE COOLANT	✓ Clean, no contamination
HYDRAULIC FLUID	✓ Clean, correct level
TRANSMISSION FLUID	✓ Clean, correct level
AXLE OIL (FRONT/REAR)	✓ Clean, correct level
FUEL SYSTEM	✓ No water, no sediment

🔧 01 / ENGINE & POWERTRAIN

— ENGINE BAY — HYUNDAI DIESEL

The **Hyundai DM02VB 4-cylinder diesel engine** was inspected cold and again after warm-up. Cold start is instant and clean; idle is stable and the engine runs smooth through the entire RPM range. A full visual inspection of the engine bay shows **no oil leaks, no coolant seepage, and no fuel weepage**. Belts and hoses are in good condition. Air filter element is clean. No fault codes present. The machine reads **930 hours** on the original working hour meter — consistent with a low-hour, well-maintained machine.



02 / HYDRAULIC SYSTEM

— MAIN & AUXILIARY HYDRAULIC PUMPS

The full hydraulic system was operated under load. **All cylinders, hoses, and fittings are dry and leak-free.** The **main hydraulic pump** and **auxiliary hydraulic system** are both reported in excellent condition. Loader lift and dump cycle smoothly with no drift. The **quick coupler / attachment interface** engages and locks correctly. Hydraulic fluid is clean and at the correct level. No weeping at any gland seals or connections.



03 / CAB & OPERATOR STATION

— CAB INTERIOR, CONTROLS & INSTRUMENTATION

The **cab interior is clean, dry, and free of damage.** All operator controls — loader levers, auxiliary function switch, foot pedals, steering, and throttle — were verified to function smoothly through their full range. The instrument cluster, hour meter, warning lights, and gauges all operate correctly. The **seat and seatbelt** and **windshield** are both reported in good condition. Road lighting and beacon are functional.



04 / AXLES, FRAME & UNDERCARRIAGE

— CHASSIS, PINS, BUSHINGS, AXLES & BRAKES

The axles, frame, and undercarriage were inspected visually and operationally. **Pins and bushings are in good condition with moderate wear** — no significant play was detected. The **axles** and **brakes** are both reported in good condition. The main frame and subframe are straight, sound, and free of any structural damage or cracking. No rust perforation or impact damage anywhere on the chassis. The **4×4 drive engagement** was tested and functions correctly.



05 / TIRES & WHEELS

— TIRE CONDITION — 10 - 16.5 NHS

All four tires are in **good condition with approximately 80% tread remaining.** Tires (10 – 16.5 NHS) show even wear across the tread face with no flat spots, cupping, or irregular wear patterns. Sidewalls are intact with no cuts, gouges, or bulge damage. Rims and wheels are straight, clean, and free of cracks or rust.



06 / LOADER ARMS & ATTACHMENTS

— LOADER ARMS, LINKAGE, BUCKET & PALLET FORKS

The **loader arms and linkage** operate smoothly through full range with no binding. Pins and bushings at the loader pivot points show **good condition with moderate wear.** The **main bucket** is in good condition with the cutting edge showing moderate wear. The **pallet forks** are in good condition with straight tines and no bending. The attachment interface engages and locks correctly with no excessive play.

PHOTO INDEX – MACHINE REFERENCE



REFERENCE 01



REFERENCE 02



REFERENCE 03



REFERENCE 04




REFERENCE 05




REFERENCE 06



REFERENCE 07

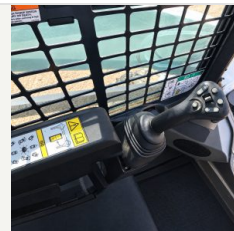

REFERENCE 08

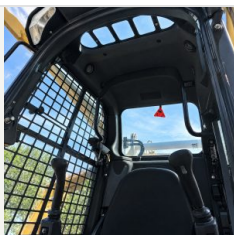

REFERENCE 09



REFERENCE 10



REFERENCE 11



REFERENCE 12



REFERENCE 13



REFERENCE 14



REFERENCE 15

WHAT YOU GET WITH THIS MACHINE



FREE DELIVERY

First 500 km free — then just €1 / km.



FULLY INSURED

Fully insured during transport across all of Europe.



6-MONTH WARRANTY

6 months across Europe — extendable to 5 years.



14-DAY REFUND

14 days to inspect on arrival. Full refund if not as described.



VERIFIED SELLER

Bolagsverket-registered. Org.nr 559155-3432.



FULL DOCUMENTATION

Ready to register in the new owner's name.

CARLOS RUIZ

CERTIFIED HEAVY-MACHINERY MECHANIC

Certification No. **ES-MECH-7723**

Spanish Heavy Equipment Institute

03 OCTOBER 2026

DATE OF INSPECTION

Report No. **INSP-2026-10-S590**

Location: **Burgos, ES**

Inspector statement & disclaimer: This machine was inspected on 03 October 2026 by a certified heavy-machinery mechanic. Operational tests were performed under no-load and light-load conditions. All findings reflect the condition of the machine on that date and represent a good-faith assessment. The buyer has a 14-day post-delivery inspection window to independently verify the machine on arrival, with full refund protection under our refund policy. Final sale price is confirmed at auction close.

BRINGELANDS MASKINHANDEL AB

ORG.NR 559155-3432 · VAT SE559155343201

ADLER SALVIUS GATA 15 · 411 11 GÖTEBORG · SWEDEN

BRINGELANDSMASKINHANDELAB.COM



SCAN TO VIEW
THIS MACHINE

BRINGELANDS MASKINHANDEL AB — INSPECTION COPY