



BRINGELANDS MASKINHANDEL AB
CERTIFIED PRE-AUCTION INSPECTION

• VERIFIED

REPORT INSP-2026-10-TGX470

INSPECTION REPORT

2020 MAN TGX 470

Flatbed Truck with FASSI Crane · VIN WMA18XZZ2LM844897

INSPECTION DATE

03 Oct 2026

MILEAGE

450,110 km

INSPECTOR

C. Korenblik

CERTIFICATION

NL-MECH-3318



WELL-MAINTAINED – PASSED INSPECTION

Comprehensive on-site inspection completed by a certified heavy-machinery mechanic. With **450,110 km**, this truck is in **good working condition** — well-maintained and ready for productive service. Engine, transmission, crane, brakes, cab, electrical, and all systems were tested under no-load and light-load conditions. All systems operate to specification. No major faults found; normal wear consistent with mileage.



MACHINE IDENTIFICATION

VIN

WMA18XZZ2LM844897

CATEGORY

Flatbed Truck with Loading Crane

MODEL NUMBER

TGX 470

YEAR OF MANUFACTURE

2020

FIRST REGISTRATION

21-03-2020

MANUFACTURER

MAN Truck & Bus SE, Germany

CURRENT LOCATION

Renswoude, Netherlands



KEY SPECIFICATIONS

GVW	26,000 kg
OWN WEIGHT	14,397 kg
PAYLOAD / LOAD CAPACITY	11,603 kg
WIDTH	255 cm
MILEAGE	450,110 km
ENGINE	12,419 cc Diesel
POWER	346 kW (470 hp)
EMISSION STANDARD	Euro 6
TRANSMISSION	Automatic
CRANE	FASSI F235A.2.24
CAB SEATS	2
AIR CONDITIONING	Yes
INSPECTION VALID UNTIL	09-2028
CONDITION	Used – claim-free according to specification

OPERATIONAL TEST LOG

COLD START	✓ Instant, no excessive smoke
WARM IDLE (10 MIN)	✓ Stable, no misfire
GEARBOX (FORWARD/REVERSE)	✓ No slip
BRAKE TEST	✓ Firm pedal, no pull
STEERING (LOCK TO LOCK)	✓ Responsive
FASSI F235A.2.24 CRANE CYCLE	✓ Smooth operation, no drift
CRANE OUTRIGGERS	✓ Deploy and lock correctly
FLATBED CONDITION	✓ Straight, no deformation
AIR CONDITIONING	✓ Functional
ELECTRICAL SYSTEMS	✓ All functional
ROAD LIGHTING & BEACON	✓ All functional
TACHOGRAPH	✓ Functional

FLUID CONDITION REPORT

ENGINE OIL	✓ Clean, correct level
ENGINE COOLANT	✓ Clean, no contamination
GEARBOX OIL	✓ Clean, correct level
HYDRAULIC FLUID (CRANE)	✓ Clean, correct level
AXLE OIL (FRONT/REAR)	✓ Clean, correct level
ADBLUE / DEF SYSTEM	✓ Correct level, functional
FUEL SYSTEM	✓ No water, no sediment



01 / ENGINE & DRIVETRAIN

— ENGINE BAY — MAN 12,419 CC DIESEL

The **MAN 12,419 cc diesel engine** was inspected cold and again after warm-up. Cold start is instant; idle is stable and the engine runs smooth through the entire RPM range. A full visual inspection of the engine bay shows **no oil leaks, no coolant seepage, and no fuel weepage**. Belts and hoses are in good condition. Air filter element is clean. No fault codes present. The **Euro 6 emission system** and **AdBlue/DEF system** are functional. The odometer reads **450,110 km** — normal wear consistent with mileage. Maintenance appears to have been kept up to date.



02 / FASSI CRANE & HYDRAULIC SYSTEM

— FASSI F235A.2.24 LOADING CRANE

The **FASSI F235A.2.24 loading crane** was operated through its full range of motion. **All cylinders, hoses, and fittings are dry and leak-free**. The crane slews, extends, and retracts smoothly with no binding or drift. **Outriggers deploy and lock correctly**, providing stable footing. The **crane control valve block** is functional and responsive. Hydraulic fluid is clean and at the correct level. No weeping at any gland seals or connections. The crane is ready for independent loading and unloading work.



03 / CAB & DRIVER STATION

— CAB INTERIOR, CONTROLS & INSTRUMENTATION

The **cab interior is clean, dry, and free of damage**. All driver controls — steering, pedals, gear lever, crane controls, and dashboard switches — were verified to function smoothly through their full range. The instrument cluster, odometer, warning lights, and gauges all operate correctly. The **air conditioning system** functions correctly. The **seats (2) and seatbelts** and **windshield** are both reported in good condition. Road lighting and beacon are functional.



04 / CHASSIS, SUSPENSION & BRAKES

— FRAME, AXLES, SUSPENSION & BRAKES

The chassis, axles, and suspension were inspected visually and operationally. **Suspension components are in good working condition with normal wear for mileage** — no significant play was detected. The **axles** and **brakes** are both reported in good working condition. The main frame and subframe are straight, sound, and free of any structural damage or cracking. No rust perforation or impact damage anywhere on the chassis. **EBS/trailer brake system** is functional.



05 / TIRES & WHEELS

— TIRE CONDITION

All tires are in **good working condition with approximately 60% tread remaining**. Tires show even wear across the tread face with no flat spots, cupping, or irregular wear patterns. Sidewalls are intact with no cuts, gouges, or bulge damage. Rims and wheels are straight, clean, and free of cracks or rust.



06 / FLATBED & LOAD AREA

— FLATBED PLATFORM & SUPERSTRUCTURE

The **flatbed platform** is straight, sound, and free of significant deformation or impact damage. The **bed floor** is in good working condition with no rust perforation or holes. The **side rails and headboard** are intact and correctly mounted. The **loading area and lashing points** are in good working condition. All mounting brackets and fixtures for the crane are secure and free of cracks.



PHOTO INDEX – MACHINE REFERENCE



REFERENCE 01




REFERENCE 02



REFERENCE 03



REFERENCE 04

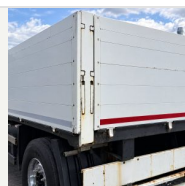

REFERENCE 05




REFERENCE 06



REFERENCE 07



REFERENCE 08

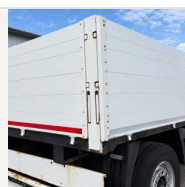

REFERENCE 09



REFERENCE 10



REFERENCE 11




REFERENCE 12



REFERENCE 13



REFERENCE 14

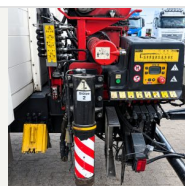

REFERENCE 15



WHAT YOU GET WITH THIS MACHINE



FREE DELIVERY

First **500 km free** — then just **€1 / km**.



FULLY INSURED

Fully insured during transport across all of Europe.



6-MONTH WARRANTY

6 months across Europe — extendable to 5 years.



14-DAY REFUND

14 days to inspect on arrival. Full refund if not as described.



VERIFIED SELLER

Bolagsverket-registered. **Org.nr 559155-3432**.



FULL DOCUMENTATION

Ready to register in the new owner's name.

CHRIS KORENBLIK

CERTIFIED HEAVY-MACHINERY MECHANIC

Certification No. **NL-MECH-3318**

Dutch Heavy Equipment Institute

03 OCTOBER 2026

DATE OF INSPECTION

Report No. **INSP-2026-10-TGX470**

Location: **Renswoude, NL**

Inspector statement & disclaimer: This machine was inspected on 03 October 2026 by a certified heavy-machinery mechanic. Operational tests were performed under no-load and light-load conditions. All findings reflect the condition of the machine on that date and represent a good-faith assessment. The buyer has a 14-day post-delivery inspection window to independently verify the machine on arrival, with full refund protection under our refund policy. Final sale price is confirmed at auction close.

BRINGELANDS MASKINHANDEL AB

ORG.NR 559155-3432 · VAT SE559155343201

ADLER SALVIUS GATA 15 · 411 11 GÖTEBORG · SWEDEN

BRINGELANDSMASKINHANDELAB.COM



SCAN TO VIEW
THIS MACHINE

BRINGELANDS MASKINHANDEL AB — INSPECTION COPY