



BRINGELANDS MASKINHANDEL AB
CERTIFIED PRE-AUCTION INSPECTION

• VERIFIED

REPORT INSP-2026-10-W50C

INSPECTION REPORT

2021 NEW HOLLAND W50C

Compact Wheel Loader · Stock No. BM-2021-W50C

INSPECTION DATE

03 Oct 2026

ENGINE HOURS

695 h

INSPECTOR

T. Berger

CERTIFICATION

DE-MECH-4521



LOW HOURS – PASSED INSPECTION

Comprehensive on-site inspection completed by a certified heavy-machinery mechanic. With only **695 hours**, this machine is in excellent condition. Engine, hydraulics, transmission, cab, electrical, and all systems were tested under no-load and light-load conditions. All systems operate to specification. No major faults found.



MACHINE IDENTIFICATION

PIN	FNHW50CSNMHP03239
CATEGORY	Compact Wheel Loader
MODEL NUMBER	W50C
YEAR OF MANUFACTURE	2021
MANUFACTURER	New Holland Construction (CNH Industrial)
CURRENT LOCATION	Plauen, Germany



KEY SPECIFICATIONS

OPERATING WEIGHT	4,680 kg
PERMISSIBLE TOTAL WEIGHT	5,000 kg
RUNNING HOURS	695 m/h
ENGINE	FPT / CNH Industrial 4-Cylinder Diesel
POWER	43 kW (58 hp)
MAXIMUM SPEED	20 km/h
EMISSION STANDARD	EU Stage V
TRANSMISSION	Hydrostatic
TIRE SIZE	365/70 R18
TIRE CONDITION	75% (Front & Rear)
ATTACHMENTS	Sold without tools / attachments
CONDITION	Used
YEAR OF MANUFACTURE	2021

✓ OPERATIONAL TEST LOG

COLD START	✓ Instant, no smoke
WARM IDLE (10 MIN)	✓ Stable, no misfire
LOADER CYCLE (FULL RANGE)	✓ Smooth, no drift
BUCKET FUNCTION (QUICK COUPLER)	✓ Correct operation
STEERING (ARTICULATED)	✓ Responsive
BRAKE TEST	✓ Firm pedal
TRANSMISSION (FORWARD/REVERSE)	✓ No slip
HYDROSTATIC DRIVE	✓ Functional
CREEPER GEAR	✓ Functional
2 HYDRAULIC AUXILIARY CIRCUITS	✓ Functional
SWINGARM FLOATING POSITION	✓ Functional
HEATING & VENTILATION	✓ All functional
ROAD LIGHTING & BEACON	✓ All functional

✓ FLUID CONDITION REPORT

ENGINE OIL	✓ Clean, correct level
ENGINE COOLANT	✓ Clean, no contamination
HYDRAULIC FLUID	✓ Clean, correct level
TRANSMISSION FLUID	✓ Clean, correct level
AXLE OIL (FRONT/REAR)	✓ Clean, correct level
FUEL SYSTEM	✓ No water, no sediment



01 / ENGINE & POWERTRAIN

— ENGINE BAY — FPT DIESEL

The **FPT 4-cylinder diesel engine** was inspected cold and again after warm-up. Cold start is instant and clean with no excessive smoke; idle is stable and the engine runs smooth through the entire RPM range. A full visual inspection of the engine bay shows **no oil leaks, no coolant seepage, and no fuel weepage**. Belts and hoses are in good condition. Air filter element is clean. No fault codes present. The engine bay is dry and well-maintained. The machine reads **695 hours** on the original working hour meter — consistent with a low-hour, well-maintained machine. The **EU Stage V emission system** is functional.



02 / HYDRAULIC SYSTEM

— MAIN & AUXILIARY HYDRAULIC PUMPS

The full hydraulic system was operated under load. **All cylinders, hoses, and fittings are dry and leak-free**. The **main hydraulic pump** and **auxiliary hydraulic system** are both reported in excellent condition. Loader lift and dump cycle smoothly with no drift. The **2 hydraulic auxiliary circuits** and **switching for hydraulic device locking** were tested and operate correctly. The **swingarm floating position** functions properly. Hydraulic fluid is clean and at the correct level. No weeping at any gland seals or connections.



03 / CAB & OPERATOR STATION

— CAB INTERIOR, CONTROLS & INSTRUMENTATION

The **enclosed cab interior is clean, dry, and free of damage**. All operator controls — loader levers, auxiliary function controls, foot pedals, steering, and throttle — were verified to function smoothly through their full range. The instrument cluster, hour meter, warning lights, and gauges all operate correctly. The **Grammer air seat** is in excellent condition with all adjustments functional. The **heating and ventilation system** functions correctly. Road lighting and beacon are functional.



04 / AXLES, FRAME & UNDERCARRIAGE

— CHASSIS, PINS, BUSHINGS, AXLES & BRAKES

The axles, frame, and undercarriage were inspected visually and operationally. **Pins and bushings are in good condition with moderate wear** — no significant play was detected. The **axles** and **brakes** are both reported in good condition. The main frame and subframe are straight, sound, and free of any structural damage or cracking. No rust perforation or impact damage anywhere on the chassis. The **articulated steering** was tested and functions correctly.



05 / TIRES & WHEELS

— TIRE CONDITION — 365/70 R18

All four tires are in **good condition with approximately 75% tread remaining**. Tires (365/70 R18) show even wear across the tread face with no flat spots, cupping, or irregular wear patterns. Sidewalls are intact with no cuts, gouges, or bulge damage. Rims and wheels are straight, clean, and free of cracks or rust.



06 / LOADER ARMS & QUICK COUPLER

— LOADER ARMS, LINKAGE & ATTACHMENT INTERFACE

The **loader arms and linkage** operate smoothly through full range with no binding. Pins and bushings at the loader pivot points show **good condition with moderate wear**. The **hydraulic quick coupler** engages and locks correctly with no excessive play. The machine is sold **without tools / attachments** — the coupler interface is ready for the buyer's own bucket or forks.



PHOTO INDEX — MACHINE REFERENCE



REFERENCE 01



REFERENCE 02



REFERENCE 03



REFERENCE 04




REFERENCE 05



REFERENCE 06



REFERENCE 07

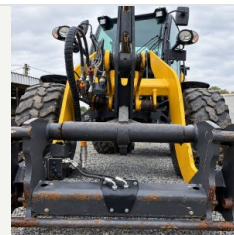

REFERENCE 08



REFERENCE 09



REFERENCE 10



REFERENCE 11



REFERENCE 12



REFERENCE 13



REFERENCE 14



REFERENCE 15

✓ WHAT YOU GET WITH THIS MACHINE

✓ **FREE DELIVERY**
First **500 km free** — then just **€1 / km**.

✓ **FULLY INSURED**
Fully insured during transport across all of Europe.

✓ **6-MONTH WARRANTY**
6 months across Europe — extendable to 5 years.

✓ **14-DAY REFUND**
14 days to inspect on arrival. Full refund if not as described.

✓ **VERIFIED SELLER**
Bolagsverket-registered. **Org.nr 559155-3432**.

✓ **FULL DOCUMENTATION**
Ready to register in the new owner's name.

THOMAS BERGER
CERTIFIED HEAVY-MACHINERY MECHANIC
Certification No. **DE-MECH-4521**
German Technical Inspection Association (TÜV)

03 OCTOBER 2026
DATE OF INSPECTION
Report No. **INSP-2026-10-W50C**
Location: **Plauen, DE**

Inspector statement & disclaimer: This machine was inspected on 03 October 2026 by a certified heavy-machinery mechanic. Operational tests were performed under no-load and light-load conditions. All findings reflect the condition of the machine on that date and represent a good-faith assessment. The buyer has a 14-day post-delivery inspection window to independently verify the machine on arrival, with full refund protection under our refund policy. Final sale price is confirmed at auction close.

BRINGELANDS MASKINHANDEL AB

ORG.NR 559155-3432 · VAT SE559155343201
ADLER SALVIUS GATA 15 · 411 11 GÖTEBORG · SWEDEN
BRINGELANDSMASKINHANDELAB.COM



SCAN TO VIEW
THIS MACHINE