



BRINGELANDS MASKINHANDEL AB
CERTIFIED PRE-AUCTION INSPECTION

• VERIFIED

REPORT INSP-2026-10-1350R

INSPECTION REPORT

2024 MANITOU 1350 R

Compact Skid Steer Loader · Stock No. NK51137

INSPECTION DATE

03 Oct 2026

ENGINE HOURS

11 h

INSPECTOR

C. Korenblik

CERTIFICATION

NL-MECH-3318



ESSENTIALLY NEW – PASSED INSPECTION

Comprehensive on-site inspection completed by a certified heavy-machinery mechanic. With only **11 hours**, this machine is in near-new condition. Engine, hydraulics, transmission, cab, electrical, and all attachments were tested under no-load and light-load conditions. All systems operate to specification. No faults found.



MACHINE IDENTIFICATION

PIN

MEA135RSC91000546

CATEGORY

Compact Skid Steer Loader

MODEL NUMBER

1350 R

YEAR OF MANUFACTURE

2024

MANUFACTURER

Manitou Group, France

CURRENT LOCATION

Apeldoorn, Netherlands



KEY SPECIFICATIONS

NET WEIGHT	2,390 kg
OPERATING MASS	2,392 kg (5,275 lbs)
RATED CAPACITY	612 kg (1,350 lbs)
RUNNING HOURS	11 m/h
ENGINE	Yanmar Diesel
POWER	34 kW (46 hp)
FUEL TYPE	Diesel (AdBlue)
AXLE CONFIGURATION	4×4
TIRES/UNDERCARRIAGE	100%
CERTIFICATIONS	EPA, CE
ATTACHMENTS	Bucket, quick-change system, additional hydraulics
CONDITION	Used (New Machine)
YEAR OF MANUFACTURE	2024

✓ OPERATIONAL TEST LOG

COLD START	✓ Instant, no smoke
WARM IDLE (10 MIN)	✓ Stable, no misfire
LOADER CYCLE (FULL RANGE)	✓ Smooth, no drift
BUCKET FUNCTION	✓ Correct operation
STEERING (LOCK TO LOCK)	✓ Responsive
BRAKE TEST	✓ Firm pedal
TRANSMISSION (FORWARD/REVERSE)	✓ No slip
4×4 DRIVE ENGAGEMENT	✓ Functional
ADDITIONAL HYDRAULIC FUNCTION	✓ Functional
ANGLE MOVEMENT	✓ Functional
QUICK-CHANGE SYSTEM	✓ Engages correctly
ELECTRICAL SYSTEMS	✓ All functional
ROAD LIGHTING & BEACON	✓ All functional

✓ FLUID CONDITION REPORT

ENGINE OIL	✓ Clean, correct level
ENGINE COOLANT	✓ Clean, no contamination
HYDRAULIC FLUID	✓ Clean, correct level
TRANSMISSION FLUID	✓ Clean, correct level
AXLE OIL (FRONT/REAR)	✓ Clean, correct level
ADBLUE SYSTEM	✓ Correct level, functional
FUEL SYSTEM	✓ No water, no sediment



01 / ENGINE & POWERTRAIN

— ENGINE BAY — YANMAR DIESEL

The **Yanmar diesel engine** was inspected cold and again after warm-up. Cold start is instant and clean with no excessive smoke; idle is stable and the engine runs smooth through the entire RPM range. A full visual inspection of the engine bay shows **no oil leaks, no coolant seepage, and no fuel weepage**. Belts and hoses are in as-new condition. Air filter element is clean. No fault codes present. The engine bay is dry and spotless. The machine reads **11 hours** on the original working hour meter — consistent with a nearly new machine. The **AdBlue system** is functional with correct fluid level.



02 / HYDRAULIC SYSTEM

— MAIN & AUXILIARY HYDRAULIC PUMPS

The full hydraulic system was operated under load. **All cylinders, hoses, and fittings are dry and leak-free**. The **main hydraulic pump** and **auxiliary hydraulic system** are both reported in excellent condition. Loader lift and dump cycle smoothly with no drift. The **quick-change system** engages and locks correctly. The **additional hydraulic function** and **angle movement** were tested and operate correctly. Hydraulic fluid is clean and at the correct level. No weeping at any gland seals or connections.



03 / CAB & OPERATOR STATION

— CAB INTERIOR, CONTROLS & INSTRUMENTATION

The **cab interior is clean, dry, and free of damage**. All operator controls — loader levers, auxiliary function controls, foot pedals, steering, and throttle — were verified to function smoothly through their full range. The instrument cluster, hour meter, warning lights, and gauges all operate correctly. The **seat and seatbelt** and **windshield** are both reported in excellent condition. Road lighting and beacon are functional.



04 / AXLES, FRAME & UNDERCARRIAGE

— CHASSIS, PINS, BUSHINGS, AXLES & BRAKES

The axles, frame, and undercarriage were inspected visually and operationally. **Pins and bushings are in as-new condition with negligible wear** — no significant play was detected. The **axles** and **brakes** are both reported in excellent condition. The main frame and subframe are straight, sound, and free of any structural damage or cracking. No rust perforation or impact damage anywhere on the chassis. The **4×4 drive engagement** was tested and functions correctly.



05 / TIRES & WHEELS

— TIRE CONDITION — 100% REMAINING

All four tires are in **excellent condition with 100% tread remaining**. Tires show no wear across the tread face with no flat spots, cupping, or irregular wear patterns. Sidewalls are intact with no cuts, gouges, or bulge damage. Rims and wheels are straight, clean, and free of cracks or rust. The **undercarriage is rated at 100%**.

— **LOADER ARMS, LINKAGE, BUCKET & QUICK-CHANGE SYSTEM**

The **loader arms and linkage** operate smoothly through full range with no binding. Pins and bushings at the loader pivot points show **as-new condition with no excessive play**. The **main bucket** is in excellent condition with the cutting edge showing minimal wear. The **quick-change system** engages and locks correctly with no excessive play. The **additional hydraulic function** and **angle movement** both operate correctly.

PHOTO INDEX – MACHINE REFERENCE



REFERENCE 01



REFERENCE 02



REFERENCE 03



REFERENCE 04




REFERENCE 05



REFERENCE 06



REFERENCE 07

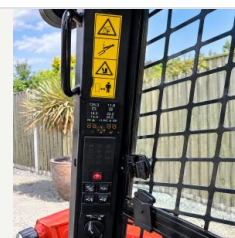

REFERENCE 08



REFERENCE 09



REFERENCE 10



REFERENCE 11



REFERENCE 12



REFERENCE 13



REFERENCE 14



REFERENCE 15

✓ WHAT YOU GET WITH THIS MACHINE



FREE DELIVERY

First **500 km free** — then just **€1 / km**.



FULLY INSURED

Fully insured during transport across all of Europe.



6-MONTH WARRANTY

6 months across Europe — extendable to 5 years.



14-DAY REFUND

14 days to inspect on arrival. Full refund if not as described.



VERIFIED SELLER

Bolagsverket-registered. **Org.nr 559155-3432**.



FULL DOCUMENTATION

Ready to register in the new owner's name.

CHRIS KORENBLIK

CERTIFIED HEAVY-MACHINERY MECHANIC

Certification No. **NL-MECH-3318**

Dutch Heavy Equipment Institute

03 OCTOBER 2026

DATE OF INSPECTION

Report No. **INSP-2026-10-1350R**

Location: **Apeldoorn, NL**

Inspector statement & disclaimer: This machine was inspected on 03 October 2026 by a certified heavy-machinery mechanic. Operational tests were performed under no-load and light-load conditions. All findings reflect the condition of the machine on that date and represent a good-faith assessment. The buyer has a 14-day post-delivery inspection window to independently verify the machine on arrival, with full refund protection under our refund policy. Final sale price is confirmed at auction close.

BRINGELANDS MASKINHANDEL AB

ORG.NR 559155-3432 · VAT SE559155343201

ADLER SALVIUS GATA 15 · 411 11 GÖTEBORG · SWEDEN

BRINGELANDSMASKINHANDELAB.COM



SCAN TO VIEW
THIS MACHINE