



BRINGELANDS MASKINHANDEL AB
CERTIFIED PRE-AUCTION INSPECTION

• VERIFIED

REPORT INSP-2026-10-SR175B

INSPECTION REPORT

2025 CASE SR175B

Compact Skid Steer Loader · Stock No. VIN 818

INSPECTION DATE

03 Oct 2026

ENGINE HOURS

30 h

INSPECTOR

J. Novák

CERTIFICATION

SK-MECH-4417



ESSENTIALLY NEW – PASSED INSPECTION

Comprehensive on-site inspection completed by a certified heavy-machinery mechanic. With only **30 hours**, this machine is in near-new condition. Engine, hydraulics, transmission, cab, electrical, and all attachments were tested under no-load and light-load conditions. All systems operate to specification. No faults found.



MACHINE IDENTIFICATION

PIN

JAFSR175CSM467180

CATEGORY

Compact Skid Steer Loader

MODEL NUMBER

SR175B

YEAR OF MANUFACTURE

2025

MANUFACTURER

CNH Industrial America LLC, Racine, WI, USA

CURRENT LOCATION

Levice, Slovakia



KEY SPECIFICATIONS

TRANSPORT DIMENSIONS (L×W×H)	3.3 m × 1.64 m × 1.97 m
OPERATING WEIGHT	2,842 kg
RATED OPERATING CAPACITY	790 kg (50% of tipping load)
RUNNING HOURS	30 m/h
ENGINE	Perkins 404D-22T Diesel
HORSEPOWER	67 hp / 50.0 kW
TIRE SIZE	10×16.5 (Heavy Duty)
TIRE CONDITION	95%
ATTACHMENTS	Main bucket, hydraulic quick coupler
CONDITION	Used
YEAR OF MANUFACTURE	2025



OPERATIONAL TEST LOG

COLD START	✓ Instant, no smoke
WARM IDLE (10 MIN)	✓ Stable, no misfire
LOADER CYCLE (FULL RANGE)	✓ Smooth, no drift
BUCKET FUNCTION	✓ Correct operation
STEERING (LOCK TO LOCK)	✓ Responsive
BRAKE TEST	✓ Firm pedal
TRANSMISSION (FORWARD/REVERSE)	✓ No slip
RIDE CONTROL SYSTEM	✓ Functional
ELECTRO-HYDRAULIC (EH) CONTROLS	✓ Responsive
8-INCH LCD DISPLAY	✓ All functions
REAR CAMERA	✓ Operational
A/C & HEATER	✓ Functional
ROAD LIGHTING & BEACON	✓ All functional

FLUID CONDITION REPORT

ENGINE OIL	✓ Clean, correct level
ENGINE COOLANT	✓ Clean, no contamination
HYDRAULIC FLUID	✓ Clean, correct level
TRANSMISSION FLUID	✓ Clean, correct level
AXLE OIL (FRONT/REAR)	✓ Clean, correct level
FUEL SYSTEM	✓ No water, no sediment

01 / ENGINE & POWERTRAIN

— ENGINE BAY — PERKINS DIESEL

The **Perkins 404D-22T diesel engine** was inspected cold and again after warm-up. Cold start is instant and clean with no excessive smoke; idle is stable and the engine runs smooth through the entire RPM range. A full visual inspection of the engine bay shows **no oil leaks, no coolant seepage, and no fuel weepage**. Belts and hoses are in as-new condition. Air filter element is clean. No fault codes present. The engine bay is dry and spotless. The machine reads **30 hours** on the original working hour meter — consistent with a nearly new machine.

02 / HYDRAULIC SYSTEM

— MAIN & AUXILIARY HYDRAULIC PUMPS

The full hydraulic system was operated under load. **All cylinders, hoses, and fittings are dry and leak-free**. The **main hydraulic pump** and **auxiliary hydraulic system** are both reported in excellent condition, delivering **78.0 L/min at 210 bar** (standard flow). Loader lift and dump cycle smoothly with no drift. The **hydraulic quick coupler** engages and locks correctly. Hydraulic fluid is clean and at the correct level. No weeping at any gland seals or connections.

03 / CAB & OPERATOR STATION

— CAB INTERIOR, CONTROLS & INSTRUMENTATION

The **enclosed cab interior is clean, dry, and free of damage**. All operator controls — electro-hydraulic joysticks, auxiliary function controls, foot pedals, and throttle — were verified to function smoothly through their full range. The **8-inch LCD multi-function display**, hour meter, warning lights, and gauges all operate correctly. The **rear camera** provides a clear image. The **A/C and heater system** functions correctly. The **deluxe air suspension seat** and seatbelt are in excellent condition. Road lighting and beacon are functional.

04 / AXLES, FRAME & UNDERCARRIAGE

— CHASSIS, PINS, BUSHINGS, AXLES & BRAKES

The axles, frame, and undercarriage were inspected visually and operationally. **Pins and bushings are in as-new condition with negligible wear** — no significant play was detected. The **axles** and **SAHR disc parking brakes** are both reported in excellent condition. The main frame and subframe are straight, sound, and free of any structural damage or cracking. No rust perforation or impact damage anywhere on the chassis.

05 / TIRES & WHEELS

— TIRE CONDITION — 10×16.5 (HEAVY DUTY)


All four tires are in **excellent condition with approximately 95% tread remaining**. Tires (10×16.5 heavy duty) show even wear across the tread face with no flat spots, cupping, or irregular wear patterns. Sidewalls are intact with no cuts, gouges, or bulge damage. Rims and wheels are straight, clean, and free of cracks or rust.

06 / LOADER ARMS & BUCKET ATTACHMENT

— RADIAL LIFT ARMS, LINKAGE & MAIN BUCKET

The **radial lift loader arms and linkage** operate smoothly through full range with no binding. Pins and bushings at the loader pivot points show **as-new condition with no excessive play**. The **main bucket** is in good condition with the cutting edge showing minimal wear. The **hydraulic quick coupler** engages and locks correctly with no excessive play.

PHOTO INDEX – MACHINE REFERENCE

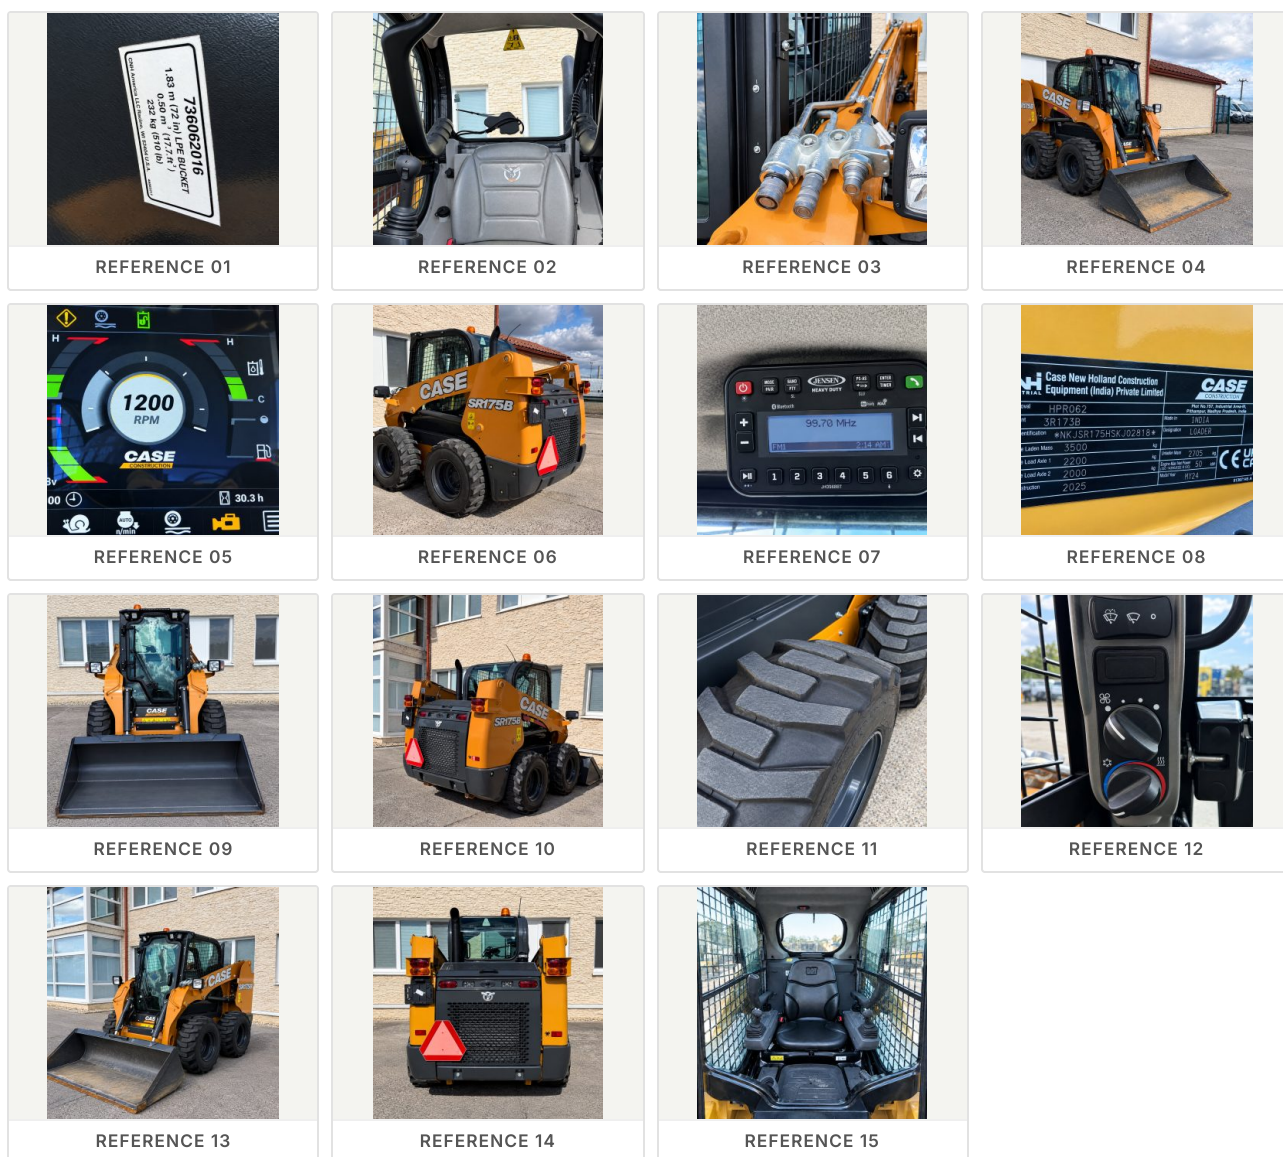

WHAT YOU GET WITH THIS MACHINE

 **FREE DELIVERY**
 First 500 km free — then just €1 / km.

 **FULLY INSURED**
 Fully insured during transport across all of Europe.

 **6-MONTH WARRANTY**
 6 months across Europe — extendable to 5 years.

 **14-DAY REFUND**
 14 days to inspect on arrival. Full refund if not as described.

 **VERIFIED SELLER**
 Bolagsverket-registered. Org.nr 559155-3432.

 **FULL DOCUMENTATION**
 Ready to register in the new owner's name.

JÁN NOVÁK

CERTIFIED HEAVY-MACHINERY MECHANIC

Certification No. **SK-MECH-4417**

Slovak Technical Inspection Authority (STK)

03 OCTOBER 2026

DATE OF INSPECTION

Report No. **INSP-2026-10-SR175B**

Location: **Levice, SK**

Inspector statement & disclaimer: This machine was inspected on 03 October 2026 by a certified heavy-machinery mechanic. Operational tests were performed under no-load and light-load conditions. All findings reflect the condition of the machine on that date and represent a good-faith assessment. The buyer has a 14-day post-delivery inspection window to independently verify the machine on arrival, with full refund protection under our refund policy. Final sale price is confirmed at auction close.

BRINGELANDS MASKINHANDEL AB

ORG.NR 559155-3432 · VAT SE559155343201

ADLER SALVIUS GATA 15 · 411 11 GÖTEBORG · SWEDEN

BRINGELANDSMASKINHANDELAB.COM



SCAN TO VIEW
THIS MACHINE

BRINGELANDS MASKINHANDEL AB — INSPECTION COPY